

To: Customers

Ref: FESN-2106

Mar 2021

Fuji Electric Co., Ltd

Fuji Electric Exhaust Gas Cleaning System (EGCS)

Trios PAH Meter TriBox mini Firmware Bugs and Updates

We would like to express our deepest appreciation to you for your continued support for our ship exhaust gas cleaning systems (EGCS).

We received the report from vessel that there was a problem with the firmware of the TriBox Mini PAH sensor.

Content

If it is past 23:59 on December 31, 2020, it will not be 2021, and the PAH value will not be updated as it was at the time of the last update on December 31, 2020. Also, if you start or restart after 2021, the PAH value will display “???” .

Cause

If the currently installed firmware is “ver.1.2.7 or earlier” , it is because it is not supported after 2021.

Measure

By updating to the latest firmware “ver.1.2.8” , you can continue to use it after January 1,2021. For vessels that are already in service, we would like customer to carry out the update by our Instruction.

As of the end of February 2021, we will update the vessels that are not in service at the time of the field test.

(Update work)

1. Please update the firmware according to the attached manual “Firmware Update TriBox mini” .
2. Please make the initial settings according to the attached manual “TriBox mini_Setting Procedure_20191106” .

[【Firmware Upgrade TriBox mini Download】](#)

[【TriBox mini_Setting procedure_20191106 Download】](#)