MT6M9794e: Mounting instruction of PressFIT-pin type Small-PIM ver.1.5

Mounting instruction of PressFIT-pin type Small-PIM

Revised Records				
Date	Version	Contents		
Apr25 th -2013	1.0	-		
May-9 th -2013	1.1	Change of press-in force		
June-5 th -2014	1.2	Module Mounting process to a heat sink,		
		PCB fixing process to the module and the heat sink		
Jan27 th -2016	1.3	Attention about thermal paste		
Oct28 th -2016	1.4	Attention about thermal paste		
Nov30 th -2017	1.5	Revised minimum end hole diameter of PCB		

	CONTENTS	Page
1	General Information	2
2	Requirements for PCB	3
3	Mounting and removing process of PCB	4
4	Example of tools for PCB press-in and push-out	5
5	Example of mounting process of a module from PCBs; Press in	6
6	Example of removing process of a module from PCBs; Push out	6
7	Fixing a PCB to the Module	7
8	Requirements for a Heat Sink	7
9	Application of Thermal Paste	8
10	Mounting the Module to a Heat Sink	8-9
11	Fixing a PCB to a Heat Sink	10
12	Storage and Transport condition	10



1 General Information

This application note describes the recommended PCBs specification and advises for mounting/removing process of Fuji Electric (here in after Fuji) PressFIT-pin type Small-PIM. It is called Small-PressFIT in this report.

This application note cannot cover every type of application and/or conditions. Therefore, Fuji Small-PressFIT, which is used out of these suggestions on PCB and mounting process, will not have any warranty and/or guarantee under any circumstances. We recommend you or your technical partners to confirm throughout electro-mechanical evaluation in practical applications.

The PressFIT technology provides solder less mounting onto PCB with low resistive stable contact. A PressFIT pin before insertion has opened shape as shown in Fig.1. After press-in processes, which are described in later section, the pin is closed by the contact pressure from both sides (Fig.2). During the press-in process, mechanical deformation of pin and materials of the PCB hole sidewall form cold-welding joints, it is possible to have low resistivity and stable contact with this new technology.



Fig.1 PressFIT pin





2 Requirements for PCBs



Fig. 3 An example of a PCB

This chapter describes the PCB recommendation for the Small-PIM.

Fig. 3 shows an example of a PCB. *It is a temporary PCB for measurement, is not an actual PCB for inverter application. The PCB needs 2 holes for screwing the module to a heat sink. The distance between two holes is 53.0±0.1mm. The PCB needs 4 through-holes for M2.5 screw fixing the PCB to the module.

Table 1. Requirements for PCBs					
	min.	typ.	max.		
Drill hole diameter	1.12mm	1.15mm			
Cu thickness in hole	25µm		50µm		
Metallization in hole			15µm		
End hole diameter	0.99mm		1.09mm		
Cu thickness of conductors	35µm	70µm	400µm		
		105µm			
Metallization of circuit board	Tin (chemically)				
Metallization of pin	Tin (galvanic)				
PCB material	FR4				



Fig. 4 Description of each dimension

PCB should have been designed within criteria in the Table1. For example, end hole diameter should be a range of 0.99mm to 1.09mm with properly Sn/Cu plated sidewall as described in the figure. When it smaller, mechanical issue in the press-in process would be found, on the other hands, if it bigger, contact reliability may have concerns.

These results were experimentally obtained based from IEC60352-5. The evaluation is separately needed if PCBs which have out of these parameters.

PCB should have holes for guide pins of press-in tools with a specific position, hole diameter so that press-in lower and upper tool contact first and absorb the insertion force to protect PCB and its surface mounted devices from mechanical stress during press-in process.



In order to avoid risk of mechanical damage of other components mounted on PCB surface, we recommend reserving specific area, which would have high strain during press-in and/or push-out process. Basically, we recommend reserving 5mm in distance from the center of PressFIT pins.

3 Mounting and removing process of PCB



Fig. 5 PCB Mounting and removing machine

The procedure for mounting process of PCB is described in this section. Small-PressFIT should be inserted within a specific range of mounting speed and force. If mounting force were below the limit, the module would have issue in low resistive and stable contact. On the other hand, mechanical damage on PCB and other parts mounted on the surface would be expected if too much press-in force.

When press-in, we recommend using the equipment as shown in Fig.5 to have accurate control in force control. We also recommend using specific press-in and push-out tools provided in the latter section. Typical press-in speed is 25mm/min. to have low and stable contact and avoid module and/or PCB destruction. Typical press-in force is varying with end hole diameter of your PCB.

Recommended press-in force/1module is calculated as below;

Press-in force/1 module = 60 ~ 100 N x pin number

*Press-in force/1 module cannot exceed 4kN in order to avoid module and/or PCB destruction.



4 Example of tools for PCB press-in and push-out

Figures 6(a)-(e) are example of press-in and push-out tool set. Please contact us to know detail of the tools or get CAD data of drawings.



Fig.6(a) press-in tool set for Type1



Fig.6(c) press-in tool set for Type2



Fig.6(e) backside of upper tool



Fig.6(b) press-out tool set for Type1



Fig.6(d) press-out tool set for Type2



5 Example of mounting process of the module into the PCBs; Press-in



Fig.7 Example of Press-in Process

Figures 7(a)-(d) are example of mounting process of the module into the PCB:press-in process. (a): set an upper tool and a lower tool on the machine, (b): set a PCB on the lower tool, (c): set a module on the PCB, (d): press the backside of the module by the upper tool to press-in the module to the PCB.

6 Example of removing process of the module from the PCBs: Push-out



Figures 8(a)-(d) are example of push-out process. (a): set an upper tool and a lower tool on the machine, (b): set a module and a PCB on the lower tool, (c): press PressFIT pins of the module by the upper tool to push-out the module from the PCB, (d): the module is removed from the PCB and drops into the lower tool.





Fig. 9(a)Fix a PCB to the module by screws





Fig. 9(b)Guide holes for a screw (1B)



Fig. 9(c)Guide holes for a screw (2B)

Fig. 9(d)Cross section of a guide hole

After PCB mounting process, it is recommended to fix a PCB to the module by screws because of the press-fit contact reliability. Fig. 9(a) shows an example of fixing process. M2.5 screws are suitable. The effective length of a screw except the PCB thickness, have to be 4.0-8.0mm. Screwdriver speed n must be smaller than 300rpm, screw driver torque; 0.4Nm±10% is recommended.





Fig. 10(b) Flatness of a heat sink

A heat sink for module assembly must fulfill below surface condition.

(1)The roughness of a heat sink must be smaller than $10 \mu m.$

(2)The heat sink flatness based on a length of 100mm must be smaller than $50\mu m$.

*The flatness must be less than above value in the module mounting area including two screw clamps.







Fig. 4 Stencil printing process

Thermal paste thickness strongly affects the thermal resistivity between the module and a heat sink. Stencil printing process is recommended to control thermal paste thickness. Fig. 4 shows an example of stencil printing process. Thermal paste thickness 80µm is recommended.

An example of recommendation thermal paste is indicated in table 1.

	ample of thermal paste
Model	Manufacturer
G-776	Shin-Etsu Chemical Co., Ltd.
TG320	NIHON HANDA Co.,Ltd.

Table1 Example of thermal paste

10 Mounting the Module to a Heat Sink

In case of mounting on a heat sink, use thermal paste to secure thermal conductivity. If the thermal paste amount was not enough or applying method was not suitable, its spreading will not be enough, then thermal conductivity will be worse and thermal run away destruction may occur. Confirm spreading condition of the thermal paste. Power cycle capability is possibly decreased due to deterioration or depletion of the thermal paste in high temperature operation if an improper thermal paste is used. Please pay careful attention to selection of a proper thermal grease.

(Spreading condition of the thermal paste can be confirmed by removing the module after mounting.)





Fig. 5 shows an example of mounting process by screwing. If mounting process is applied after soldering, a PCB must have two holes for screwing. M4 screws and ϕ 9mm washers are recommended. Recommend screw torque and screw sequence is shown in fig. 5(b). In the screwing process, the module should be held in place in order not to lean.



Fig. 6 An example of removal process after the screwing

Fig. 6(a); Slide the module horizontally to the outside of the heat sink carefully, don't lift up.

Fig. 6(b); Insert a thin plate between the module and the heat sink carefully.

After the module has been set on the thermal paste, it is possible to remove the module from the heat sink before the module is screwed to the heat sink.

After the screwing, it is not recommended to remove the module from the heat sink because it causes a module failure arising from a module structure deformation.

In case of removing the module from the heat sink, please try below methods. It needs special attention for the removal process to avoid module destruction or failure. It is recommended to check the isolation of the module after the removal process.



11 Fixing a PCB to a Heat Sink

To ensure solder joint reliability against vibration, it is good to fix a PCB to a heat sink by spacers and screws. Fig. 7 shows an example of fixing process.

The arrangement of a spacer is restricted to avoid excess stress of solder joint. The distance between the module outer edge and the spacer center line must be more than 5.0cm in case that fixing process is after soldering. In case that fixing process is before soldering, the distance less than 5.0cm is allowable.



12 Storage and Transport condition

(1) The module should be stored at a standard temperature of 5 to 35°C and humidity of 45 to 75%.

Be careful to solderability of the terminals if the module has passed over one year from manufacturing date, under the above storage condition.

(2) Store modules in a place with few temperature changes in order to avoid condensation on the module surface.

(3) Avoid exposure to corrosive gases and dust.

- (4) Avoid excessive external force on the module.
- (5) Store modules with unprocessed terminals.
- (6) Do not drop or otherwise shock the modules when transporting.





WARNING

- 1. This Catalog contains the product specifications, characteristics, data, materials, and structures as of November 2016. The contents are subject to change without notice for specification changes or other reason. When using a product listed in this Catalog, be sure to obtain the latest specifications.
- 2. All applications described in this Catalog exemplify the use of Fuji's products for your reference only. No right or license, either express or implied, under any patent, copyright, trade secret or other intellectual property right owned by Fuji Electric Co., Ltd. is (or shall be deemed) granted. Fuji Electric Co., Ltd. makes no representation or warranty, whether express or implied, relating to the infringement or alleged infringement of other's intellectual property rights which may arise from the use of the applications described herein.
- 3. Although Fuji Electric Co., Ltd. is enhancing product quality and reliability, a small percentage of semiconductor products may become faulty. When using Fuji Electric semiconductor products in your equipment, you are requested to take adequate safety to prevent the equipment from causing a physical injury, fire, or other problem if any of the products become faulty. It is recommended to make your design failsafe, flame retardant, and free of malfunction.
- 4. The products introduced in this Catalog are intended for use in the following electronic and electrical equipment which has normal reliability requirements.
 - Computers
 OA equipment
 Communications equipment (terminal devices)
 Machine tools
 Audiovisual equipment
 Electrical home appliances
 Personal equipment
 Industrial robots etc
- 5. If you need to use a product in this Catalog for equipment requiring higher reliability than normal, such as for the equipment listed below, it is imperative to contact Fuji Electric Co., Ltd. to obtain prior approval. When using these products for such equipment, take adequate measures such as a backup system to prevent the equipment from malfunctioning even if a Fuji's product incorporated in the equipment becomes faulty.
 - •Transportation equipment (mounted on cars and ships) •Trunk communications equipment
 - •Traffic-signal control equipment •Gas leakage detectors with an auto-shut-off feature
 - •Emergency equipment for responding to disasters and anti-burglary devices •Safety devices
 - ·Medical equipment.
- 6. Do not use products in this Catalog for the equipment requiring strict reliability such as the following and equivalents to strategic equipment (without limitation).
 - •Space equipment •Aeronautic equipment •Nuclear control equipment •Submarine repeater equipment
- 7. All rights reserved. No part of this Catalog may be reproduced without permission in writing from Fuji Electric Co., Ltd.
- 8. If you have any question about any portion in this Catalog, ask Fuji Electric Co., Ltd. or its sales agents before using the product. Neither Fuji Electric Co., Ltd. nor its agents shall be liable for any injury caused by any use of the products not in accordance with instructions set forth herein.